

Fireware XTM v11.6.3 CSP3

For XTM 2050, 1050, 8-series, 5-series, 3-Series, 2-series, XTMv

Appliance Build # 362451

WSM v11.6.3 or higher is needed to manage a Firebox running Fireware XTM 11.6.3 CSP. 11.6.3 CSP releases are cumulative.

Software Download Available here:

ftp.watchguard.com/11.6.3_CSP/CSP3/

Username: XTM_CSP

Password: S0NofTr1ton

Resolved Issues:

CSP1 (Build# 359164)

Frequent Mobile user VPN client log on/off no longer causes low memory condition. [BUG67538]

The SIP ALG now supports REFER method for call transfers. [RFE59635]

Resolved issue causing file downloads to stall when using IPS and HTTP packet filter policy. [BUG67659]

The Cisco VPN client from iOS no longer disconnects after 3 minutes of idle time. [BUG69430]

Improved the scand process recovery, to restart faster in the event of a crash

The TO agent now works properly when used with FireCluster Active /Passive. [BUG70098] [BUG69944]

Resolved issue preventing the 10Gigabit Fiber ports on the XTM 1050 from working properly. [BUG70118]

A kernel crash no longer occurs when a reset packet is sent out the 10Gigabit Fiber ports on the XTM 1050 and XTM 2050. [BUG70384] [BUG70296]

Resolved issue which caused the Master Firebox, in an XTM 2050 FireCluster, to go into an idle state after adding a new interface. [BUG70392]

The SNMP process on XTM 21-23 will now be restarted automatically in the event it becomes stuck in a dormant state. [BUG66491]

Increased the IGMP_Max_Membership for OSPF to support a larger number of VLANs with Dynamic routing. [BUG69979]

The failover time from leased line to BOVPN with OSPF/BGP has been improved. [BUG70460]

CSP2 (Build # 360219)

Improved BOVPN stability for XTM Firewalls behind a Nating device. [BUG70394, RFE59859]

Resolved issue causing the loggerd process to use a high percentage of CPU [BUG66060, BUG59979]

Resolved issue causing low memory condition when using FireCluster Active / Passive [BUG702041]

Resolved issue causing some configuration saves to not take effect when using 11.6.3 on an XTM 21 – 23 Model. [BUG70686]

CSP3 (Build # 362451)

BUG70662: The OSS-Config process no longer leaks memory

BUG67355: RSS Feeds no longer try and download RSS updates every 6 minutes. The new update interval is 24 hours.

BUG70638: Resolved issue causing the iked process to crash under certain conditions.

BUG71028: When using FireCluster Active/Passive, with DHCP relay enabled, the Virtual MAC address will no longer be sent from the Backup Master causing network disruption.

BUG70975: The SNMP process on XTM 25/26 and XTM 33 will now be restarted automatically in the event it becomes stuck in a dormant state.

Description of v11.6.3 CSP files available for download:

XTM_OS_2050_11_6_3.exe -- appliance firmware to install sysa-dl file on your PC to upload to the 2050 using policy manager or the WebUI

XTM_OS_1050_11_6_3.exe -- appliance firmware to install sysa-dl file on your PC to upload to the 1050 using policy manager or the WebUI

XTM_OS_XTM8_11_6_3.exe -- appliance firmware to install sysa-dl file on your PC to upload to the XTM 8-series using policy manager or the WebUI

XTM_OS_XTM5_11_6_3.exe -- appliance firmware to install sysa-dl file on your PC to upload to the XTM 5-series using policy manager or the WebUI

XTM_OS_XTM330_11_6_3.exe -- appliance firmware to install sysa-dl file on your PC to upload to the XTM 330 using policy manager or the WebUI

XTM_OS_XTM330_11_6_3.exe -- appliance firmware to install sysa-dl file on your PC to upload to the XTM 33 using policy manager or the WebUI

XTM_OS_XTM2_11_6_3.exe -- appliance firmware to install sysa-dl file on your PC to upload to the XTM 2-series using policy manager or the WebUI

XTM_OS_XTM2A6_11_6_3.exe -- appliance firmware to install sysa-dl file on your PC to upload to the XTM25 and XTM26 using policy manager or the WebUI

XTMv_11_6_3.ova -- file to do initial installation of XTMv

XTM_OS_XTMV_11_6_3.exe -- file to upgrade an existing XTMv installation